

Product:	Type E fuel pump
Currawong part number:	CE370-07, CE370-08, CE370-10
Serial numbers range:	All

Currawong has determined that the brushes in the Faulhaber 2224U 012 SR motors used in the Type E pump are wearing prematurely and subsequently burning out. This has been happening after approximately 100 hours of operation. This problem was not identified during endurance or testing due to differences between test procedure and normal operation mode of the pump.

Currawong recommends that customers temporarily halt use of the Type E fuel pump. Currawong will issue a procedure for inspecting the brushes shortly. Currawong is also working on rectifying this problem, which will probably involve a firmware update to the ECU. Currawong requests that customers download the latest version of cEQUIP and check that the firmware version in the ECU is version 6 or greater (in preparation for an upgrade to the new firmware).

Currawong will also issue a full Product Update Bulletin.

Update approved by:

Gavin Brett
Chief Executive Officer